



CAR INSPECTION **BASIC**



WWW.COPARTMEA.COM

POWERED BY

BeS@ji.com

NEED HELP?

infouae@copart.com



Date
Monday, January 4, 2021

Time
10:30 AM

Vehicle Details

Make
CADILLAC

Model
Escalade LWB

Year
2010

Engine Size
8-Cylinder

Mileage (KM)
224403

Fuel Type
Petrol

Regional Specs
American

Transmission
Automatic

Interior
Leather

VIN Number

Number of Keys
1

Engine

Engine Upper Cover

Pass

Drive Belt / Pulleys

Rusted pulleys

Hoses & Pipes

ABS wiring is disconnected

Engine Oil Level

Pass

Engine Oil Filler Cap

Pass

Engine Oil Leaks

Engine to transmission oil leak

Coolant Level

Pass

Coolant Cap

Pass

Radiator

Pass

Bonnet Hinge & Holder

Pass

Engine Idle

Pass

Fender Liners

Pass

Battery Condition 

Transmission

Fluid Level & Oil Leaks

Pass

Gear Selector

Pass

Noise

Pass

Gear Shifting

Pass

Please review the car diagnostic report at the end of this document for more information on the transmission condition.

Fault Photos

Drive Belt / Pulleys - Photo



[16111413138564597924830728538874](#)

Oil Leak - Photo



[16112053182841617466100569774240](#)

Hose Damage - Photo



[IMG_20210120_152053.jpg](#)

Electrical System

Key Remote

N/A

Door Lock / Unlock

Driver side features not working

A/C Control & Cooling

Pass

Fog Lights

Pass

A/C Grilles

Driver left side A/C grille adjust doesn't work. Front passenger side A/C grille adjustment broken, A/C close wheel missing.

Number Plate Lights

Pass

Wipers

Pass

Seats Adjustment (Power/Manual)

Pass

Entertainment System

Pass

Cameras

Pass

Starting & Ignition System

Pass

Headlights

Pass

High Beams

Pass

Indicators & Hazards

Pass

Interior Lights

Pass

Center Console Buttons

Pass

Windows Operation

Front and back left side not working

Horn

Pass

Brake Lights

Pass

Reverse Lights

Pass

Soft Closing Doors

N/A

Sunroof / Moonroof

Pass

Rear View / Side Mirror Electricals

Right side mirror is broken. All buttons on driver door don't work.

Brake System, Rims & Tyres

Brake Discs Front

Needs to be replaced

Brake Discs Rear

Needs to be replaced

Handbrake

Brake fault light on. Leak also prominent.

Spare Tire

Available

ABS Sensors











Wiring is cut from under and disconnected

Rims

	Brand	Condition
Front Left	OEM	Good
Front Right	OEM	Paint peeling, rust visible
Rear Left	OEM	Minor curb scratches
Rear Right	OEM	Paint peeling, rim lip bent
Spare	OEM	Good

Tyres

	Manufacturer	Date	Size	Condition
Front Left	Bridgestone Dueler H/L	2014	285/45/22	1/5
Front Right	Michelin Defender LTX	2017	285/45/22	3/5
Rear Left	Ironman iMove Gen2	2019	285/45/22	4/5
Rear Right	Bridgestone Dueler H/L	2018	285/45/22	Replace Soon
Spare	Not visible			

TOE	CAMBER	CENTER WEAR	CUPPING	EDGE WEAR	PATCH WEAR
					
Alignment Issue	Alignment Issue	Overinflation	Alignment or Front-End Issue	Under Inflation	Alignment or Front-End Issue
Front Left Tyre	Front Right Tyre	Rear Left Tyre	Rear Right Tyre		
					

Interior

Roof Lining

Pass

Rear View Mirror

Pass

Armrest & Side Pockets

Leather crack on center box

Steering Wheel Upholstery

Pass

Seats Upholstery

Regular leather cracks due to wear and tear

Gear Lever

Pass

Floor Mats

Generally dirty + wear and tear

Trunk Lining

Pass

Dashboard

Far right cover is broken

Front Windscreen

Cracked

Rear Windscreen

Wiper scratch marks.

Doors

Front left door sensor for side steps doesn't work. Driver window deep scratches. Rear left door doesn't close smoothly. Front passenger exterior door sill scratched and missing chrome extension piece.

Service History & Manuals

Service History

Not Available

User Manual





Available

Exterior & Interior Report

Paint Condition

BeS@ji
Exterior Condition Report

- Scratch
- Chip
- Dent
- Repainted
- Faded

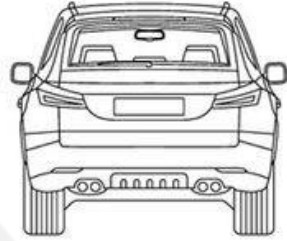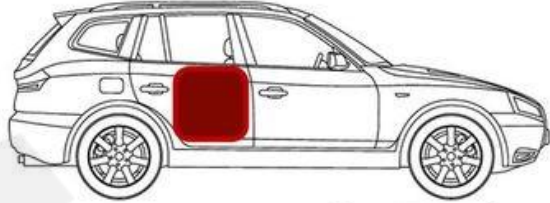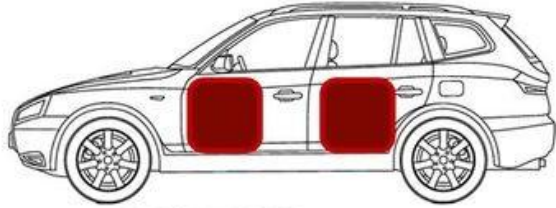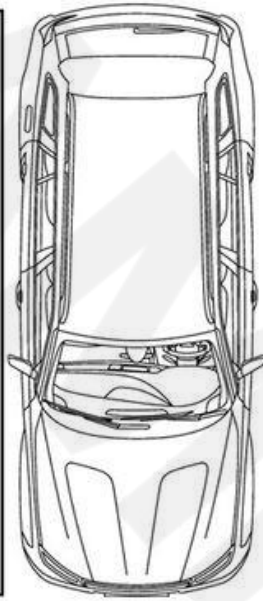

Exterior Photos

File Upload



[IMG_20210120_164802.jpg](#)



[IMG_20210120_164809.jpg](#)



[IMG_20210120_164818.jpg](#)



[IMG_20210120_164827.jpg](#)



[IMG_20210120_165020.jpg](#)



[IMG_20210120_165338.jpg](#)

Interior Photos

File Upload



[IMG_20210120_165433.jpg](#)



[IMG_20210120_165655.jpg](#)



[IMG_20210120_165715.jpg](#)



[IMG_20210120_165850.jpg](#)



[IMG_20210120_170130.jpg](#)

Vehicle Diagnostic Report

File Upload



BasicReportSample.pdf

Terms of Service

All services from BeSoji are provided on an "as is, with all defects" and "as available" basis without warranties of any kind, either expressed or implied, including without limitation, warranties of title, non-infringement, or implied warranties of merchantability or fitness for a particular purpose. Nothing in these terms or in any description of products or services in the services shall constitute a representation or warranty with respect to such products or services.

The inspection of the vehicle described in this report is external and we are unable to accept responsibility for failure to identify defects not present or apparent at the time of the inspection. Odometer readings may have been tampered with, although we report any signs that we notice of this happening during inspection. You acknowledge, by your use of the services, that such use is at your sole risk. In the event of dissatisfaction or a complaint, we reserve the right to re-examine the vehicle prior to any rectifications to the vehicle. You agree that BeSoji's liability is limited to refunding the price you pay for the inspection in the event you are dissatisfied with BeSoji's service, or injuries occur due to an unreported defect in the vehicle. All requests should be sent to hello@besoji.com within 7 days notice of receiving the report.

in no event shall either BeSoji or its affiliates or agents be liable for any direct, indirect, punitive, incidental, special or consequential damages arising out of or in any way connected with the use of the services, whether based on contract, tort, strict liability or otherwise, even if advised of the possibility of any such damages.